

4. Spark Plug Cord

A: INSPECTION

Check the following item.

- Damage to cords, deformation, burning or rust formation of terminals
- Resistance value of cords


Specified resistance:

#1 cord: 7.1 — 12.1 k Ω

#2 cord: 12.1 — 19.9 k Ω

#3 cord: 7.7 — 13.0 k Ω

#4 cord: 12.3 — 20.2 k Ω

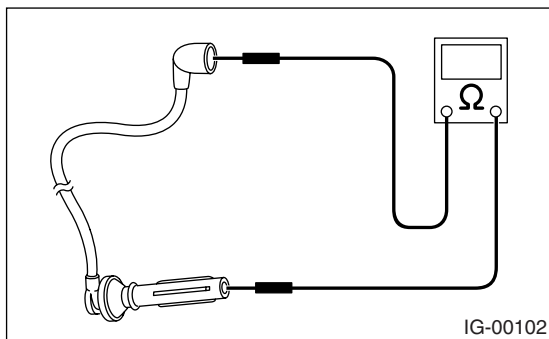

STARTING/CHARGING SYSTEMS

SC(H4SO)

	Page
1. General Description	2
2. Starter	5
3. Generator	13
4. Battery	19